

NEW YORK STATE DEPARTMENT OF ENVIRONMENTAL CONSERVATION

(1) County Putnam

(3) DEC Well Number

P1569

(2) Township Patterson



WELL COMPLETION REPORT

(4) OWNER Saddle Ridge Homes, Inc.		LOG *	
(5) ADDRESS 12 Saddle Ridge Court, Holmes, NY 12531		Ground Surface EL. _____ ft. above sea level	
(6) LOCATION OF WELL (See Instructions On Reverse) Show Lat/Long if available and method used: <u>Tommy Thurber Lane, Lot #4, Patterson, NY</u> <input type="checkbox"/> GPS <input type="checkbox"/> DEC Website <input type="checkbox"/> Map Interpolation		Top Of Casing is located <u>+1</u> ft. above (+) or below (-) ground surface	
(7) DEPTH OF WELL BELOW LAND SURFACE (Feet) <u>605'</u> <u>15 gpm</u>	(8) DEPTH TO GROUNDWATER BELOW LAND SURFACE (Feet) <u>N/A</u>	DATE MEASURED	
CASINGS		TOP OF WELL	
(9) DIAMETER <u>6"</u> in. in. in. in.		0' Drilling in overburden clay and	
(10) LENGTH <u>42'</u> ft. ft. ft. in.			
(11) GROUT TYPE / SEALING <u>portland cement</u>	(12) GROUT / SEALING INTERVAL (Feet) FROM <u>10'</u> TO <u>42'</u>		
SCREENS			
(13) MAKE & MATERIAL	(14) OPENINGS	10' Drilling in rock for casing	
(15) DIAMETER in. in. in. in.			
(16) LENGTH ft. ft. ft. in.			
(17) DEPTH TO TOP OF SCREEN, FROM TOP OF CASING (Feet)			
YIELD TEST			
(18) DATE <u>11/28/00</u>	(19) DURATION OF TEST <u>6 hours</u>	42' Set 42' of 6" casing	
(20) LIFT METHOD <input checked="" type="checkbox"/> Pump <input type="checkbox"/> Air Lift <input type="checkbox"/> Bail	(21) STABILIZED DISCHARGE (GPM) <u>7 gpm</u>		
(22) STATIC LEVEL PRIOR TO TEST (feet/inches below top of casing) <u>30'</u>	(23) MAXIMUM DRAWDOWN (Stabilized) (feet/inches below top of casing) <u>380'</u>	Drilling in rock granite	
(24) RECOVERY (Time in hours/minutes) <u>90 minutes</u>	(25) Was the water produced during test discharged away from immediate area? Yes <u>X</u> No _____		
PUMP INSTALLATION			
(26) PUMP INSTALLED? YES <u>X</u> NO _____	(27) DATE <u>11/28/00</u>	(28) PUMP INSTALLER <u>P. F. Beal & Sons, Inc.</u>	
(29) TYPE <u>submersible</u>	(30) MAKE <u>Goulds</u>	(31) MODEL <u>7GS10412</u>	
(32) MAXIMUM CAPACITY (GPM) <u>7 gpm</u>	(33) PUMP INSTALLATION LEVEL FROM TOP OF CASING (Feet) <u>400'</u>		
(34) METHOD OF DRILLING <input checked="" type="checkbox"/> Rotary <input type="checkbox"/> Cable Tool <input type="checkbox"/> Other _____	(35) USE OF WATER (see instructions for choices) <u>residential</u>		
(36) DATE DRILLING WORK STARTED <u>10/16/00</u>	(37) DATE DRILLING WORK COMPLETED <u>10/17/00</u>		
(38) DATE REPORT FILED	(39) DRILLER & COMPANY <u>Malcolm T. Beal, Jr. P. F. Beal & Sons, Inc.</u>	(40) DEC REGISTRATION NO. <u>NYRD10105</u>	
* Show log of geologic materials encountered with depth below ground surface, water bearing beds and water levels in each; casings; screens; pump; additional pumping tests and other matters of interest, e.g., water quality (sulphur, salt, methane). Describe repair work. Attach separate sheet if necessary.		605' BOTTOM OF HOLE	

See further instructions titled "Instructions for New York State Well Completion Report".

NYSDEC COPY

LOCATION SKETCH - Indicate north

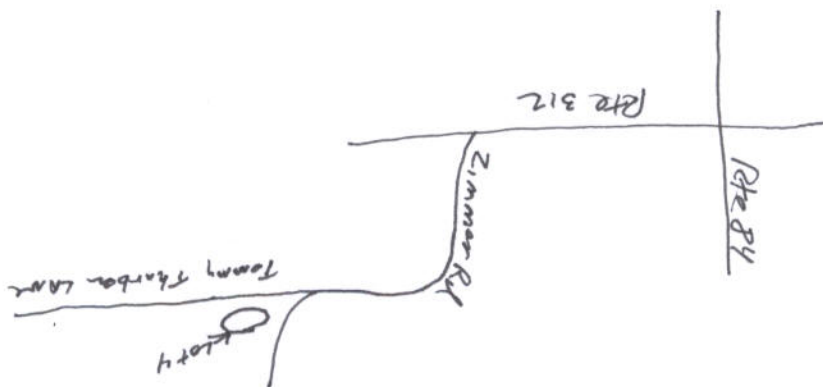

P1569

Has them for you!


Target is 41° 26' 37"N, 73° 37' 48"W - **LAKE CARMEL** quad [[Quad Info](#)]

1:25,000 1:50,000 1:100,000 1:200,000

Small

Medium

Large

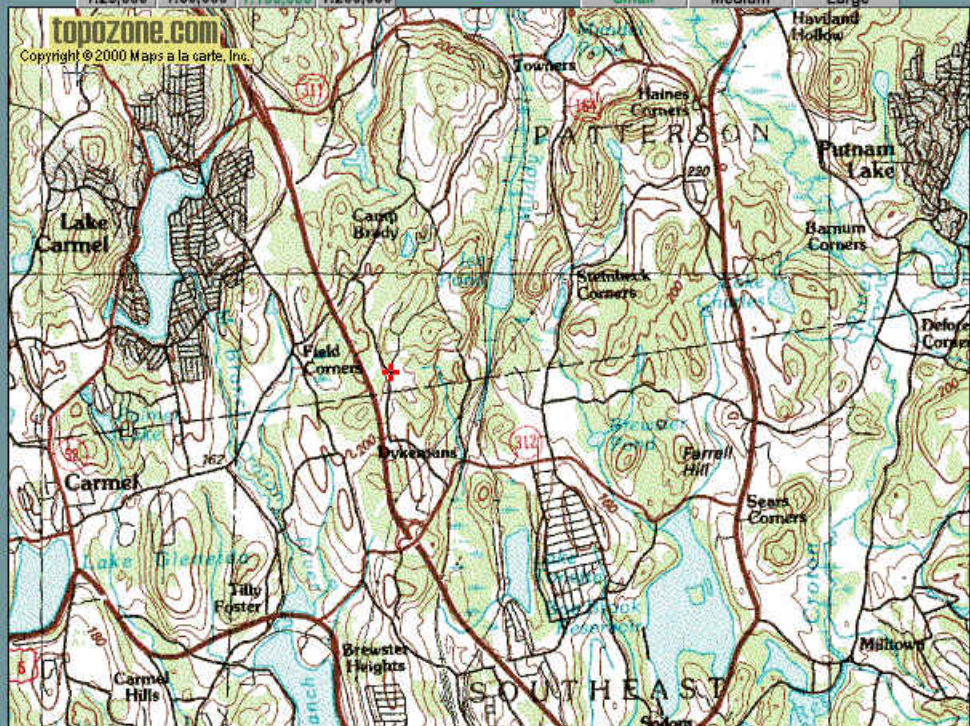

0 2000 4000 6000 8000
meters
0 2.0 4.0
miles

Coordinates (NAD27): ☐ UTM ☐ DD.DDDD ☒ D/M/S ☒ Show target symbol